Production Performance Monitoring (PPM) Application Guide



Production Performance Monitoring Application Guide Introduction

Increase process awareness and begin monitoring manufacturing throughput with a wireless Production Performance Monitoring (PPM) Kit from Banner Engineering. The PPM Kit is a modular self contained solution that can be used to monitor up to 47 lines or processes using battery-powered Q45 All-in-One Photoelectric Sensor Nodes or DC-powered Wireless TL70 Tower Light Nodes for use with already installed sensors. TL70 Tower Light Nodes can be equipped with lighted segments for local line speed indication without any additional configuration.

This application enables quicker responses from line operators to increase production speeds when throughput rates are low, and empowers process and automation engineers with real data for continuous improvement without the need to change any programming on their production process.

This application guide demonstrates how to bind the Wireless Q45 All-in-One Photoelectric Sensor Nodes and Wireless TL70 Tower Light Nodes to the DXM Controller and how to load the pre-configured XML and ScriptBasic files. Operators can quickly be up and running by entering line speed information directly into the DXM using the built-in screen and buttons. The system can be further customized for specific application requirements.

Guide Features and Bnts

Performance Calculations	Calculates line performance by companing the actual line throughput to a user-defined ideal state.
Part Counting	Use up to 47 battery-powered Q45 All-in-One Photoelectric Sensor Nodes or Wireless TL70 Tower Light Nodes for part counting up to 960 parts per minute
Track line speeds	Calculates the parts per minute rates for each sensor and gives the instantaneous rate and a daily averaged rate
Monitors Machine Status	Determines line status (running, slow, or stopped) based on user-defined throughput rates; tracks changes of event and monitors length of events
Status Alerting	User-configured allert settings for extended slow or stopped conditions
Remote Monitoring	Pushes data to Banner's Cloud Data Services for remote viewing, generating automatic dashboards, generating alerts, and logging data.

Equipment

Users can order a Production Performance Monitoring Kit that includes the base hardware for the solution and can expand it by adding additional Q45 All-in-One Photoelectric Sensor Nodes and/or Wireless TL70 Tower Light Nodes. The pre-configured PPM Kit comes with a single DXM1200 and one Q45 Sensor Node and/or TL70 Node. Users can also build their own kit and manually configure the solution.

Table 1: Pre configured kit models and components

Model	Frequency	Sensing Mode	Kit Components
PPM-DKIT-9	900 MHz 19M Sand	- ೧-ಗ್-ಆಹ	OXM 1200 61R1 912310 Wvetess Convigiler OX90NDQ4900 All on One O Cell Sensor Node PSW 24-1 Power Supply, UM630UP bracket, and a 90 day vival for Banner COS
PPM-DKIT-2	2.4 GHz ISM Sand		OXM 1200 8193 812311 Wv අදහා Convigue/ OX80N2Q4900 All in One O Cell Sensor Node PSW 24 1 Power Supply, UM830UP bracket, and a 90 day vival for Banner COS
PPM-LPKIT-9	900 MHz 19M Sand	მდადი დ იდა ა დ	OXM1200 81R1 812310 Wretess Convoller OX80N9Q49LPO All in One O Cell Sensor Mode PSW 24-1 Power Supply, UM830LP bracket, BRT 2X2 reflector, and a 90 day to all for Banner COS
PPM-LPKIT-2	2 A GHz ISM Band		OXM1200 8193 812311 Wretess Convoller OX80N2Q49290 All in One O Cell Sensor Mode PSW 24-1 Power Supply, UM83002 bracket, 89T 2X2 reflector, and a 90 day that for Banner COS
PPM-TLKIT-9	900 MHz 19M 8and	Wydess Node	OXM1200 81R1 912310 W/#ess Convole/ 8 TL700XN9 Q5 W/#ess 8ase Module PSW 24 1 Power Supply (qsy 2), S1SA F123SX M123X4 Q adapter, C98 M1290M1250 T spriner, UM830LP bracket and a 90 day wall for 8anner COS
PPM-TLKIT-2	2 A GHz ISM Sond	SWS assiads Suita redinter a	OXM1200 8193 812311 Wretess Controller 8 Tu700XV2 QS Wretess Base Module PSW 24 1 Power Supply (qsy 2), S1SA F123SX M123X4 Q adapter, CSB M1290M1250 Tisphiler, UMB30LP by acket and a 90 day wall for Banner COS

Build your own Kit— Users can build their own kit and customize individual component choices.

Select what radio frequency can be used:

900 MHz

2.4 GHz

2. Select a DXM Controller/gateway/Edge device:

DXM700

DXM1000

DXM1200

Select how many lines are being monitored (Number of Nodes) and what sensor is suitable for monitoring. Any combination of the following devices is compatible with the PPM Kit:

Diffuse

Retroreflective

Tower Light Node for use with any PNP sensor

4. Add optional accessories as needed

Refer to Table 2 on p. 2 for suggested models and to Optional Accessories on p. 2 for suggested brackets, power supplies, and cables.

Table 2: Solution components

Model		Description	
900 MHz	2.4GHz	Description	
DXM1200-B1R1	DXM1200-B1R3	OXM Series Wretess Controller , system comparate with OXM700, OXM1000, or OXM1200 Wretess Controllers	
DX80N9Q45DD	DX80N2Q45DD	Wyeless All in One O Cell Photoelecvic Officse Sensoy Node	
DX80N9Q45LPD	DX80N2Q45LPD	Wyeless All in One O Cell Photoelecvic Revoyellective Sersoy Node	
B-TL70DXN9-Q5	B-TL70DXN2-Q5	TU70 Wireless base module for PNP sensors	

Optional Accessories

Accessory	Model	Description
	SG-TL70-G	Green TL70 Wireless Base Segment for Status Indication
	SG-TL70-Y	Yellow TL70 Wireless Base Segment for Status Indication
	SG-TL70-R	Red TL70 Wireless Base Segment for Status Indication
9	TL70DXN9GYRQ	TL70 Wireless Tower Light with counter input, 900 MHz
	TL70DXN2GYRQ	TL70 Wireless Tower Light with counter input, 2.4 GHz
	PSW-24-1	DC power supply with wall plug , 100-240 V AC 50/60 Hz input, 24 V DC 1 A output, UL Listed Class 2 (comes with lot, power supply for the DXM controller and TL70)
	S15A-F1235X-M123X4-Q	S1SA In-Line Adapter for adapting sensor output (black wirelpin 4) to TL70 in put wire (gray wirelpin 5)
%	CSB-M1250M1250-T	M12 straight T splitter connector for use with TL70 and S15A In-Line Adapter
	LMB30LP	Low-profile mounting bracket for Q45s and TL70 Wheless Base Segment

Accessory	Model	Description
	SMB30A	Right-angle Mounting Bracket for Q45s and TL70 Wireless Base Segment
	BRT-2X2	Retroreflector, square \$1 mm × \$1 mm for use with Q45 Retroreflective All⊣n-One Sensor Node
SECTION OF	BWA-BATT-011	3.6 V Бинил D Сен Replacement Важегу

Step 1: Set the DIP Switches

The Q45 All-in-One Photoelectric Sensor Nodes and WirelessTL70 Tower Light Node require specific DIP switch settings to operate correctly with the PPM Kit.

Table 3: DIP switch positions

Model	DIP Switch 1	DIP Switch 2	DIP Switch 3	DIP Switch 4
Q4SDD and LPD All-in-One Nodes	OFF	OFF	ON	OFF
TL70 Tower Light Node	OFF	OFF	ON	OFF

For detailed instructions about how to access the DIP switches, refer to the Q45DD and LPD datasheet (p/n 223998) and the Wireless TL70 Tower Light Node datasheet (p/n 185469).

After making changes to the DIP switches, cycle power to the Q45s and/or the TL70. To cycle the power to any battery-powered radios, enter binding mode and then exit binding mode (with or without binding). For instructions on how to enter/exit binding mode, see Step 2: Bind the Q45 and Tower Light Nodes on p. 3.

Step 2: Bind the Q45 and Tower Light Nodes

The binding process establishes a secure radio connection between the Nodes and the DXM Controller. Follow these steps to bind the Q45 All-in-One Photoelectric Sensors and/or TL70 Nodes to your DXM Controller.

Before beginning the binding procedure, apply power to all the devices.

- On the DXM: Enter binding mode by going to the Main menu and selecting ISM Radio > Binding.
- 2. Select the Node ID you would like to assign to the Q45 or TL70 Node.

Assign each Node a unique Node ID. Node IDs 1 through 47 are the valid selections. Banner Engineering recommends binding Nodes in order (Node 1, Node 2, etc).

- 3. Press Enter to start the binding procedure.
- 4. Enter binding mode on a Q45 or TL70.
 - On the Q45 All-in-One Photoelectric Sensors: Access the binding button by unscrewing and lifting the plastic cover.
 Press the binding button three times.
 - On the TL70: Access the binding button by holding the base module and twisting the cover counter-clockwise and pulling the cover off. Press the binding button three times.

The red and green LEDs flash alternately and the radio searches for a DXM in binding mode. After the device is bound, the LEDs stay solid momentarily (appears orange), then flash four times. The radio exits binding mode.

- Label the Node's ID number with the supplied Device ID sticker.
- On the DXM: Press Back to return to the Bind to # screen.If the Node is bound and synchronized with the DXM, the green status LED flashes.
- Repeat these steps for as many Nodes as are needed for your network.
- 8. After binding all Nodes, exit binding mode on the DXM by pressing Back until you return to the Main menu.

Step 3: Conduct a Site Survey from the DXM

Conduct a Site Survey to verify the wireless communication between the radios within your wireless network. Conduct the site survey when the Nodes and DXM Controller are at the proposed installation sites to determine each radio's signal strength with the DXM.

1. On the DXM: Use the arrow buttons to select the ISM Radio menu and press ENTER.

- Select the Site Survey menu and press ENTER.
- Use the Up or Down arrows to select the device ID number and press ENTER to run the site survey with that radio.
 The site survey results display as green, yellow, red, and missed packets. Green indicates the highest signal strength, then yellow, and red. Missed packets were not received.
- 4. When you are finished running the Site Survey, press Back twice to return to the main menu and exit site survey mode.

If the Site Survey fails (100 missed packets), verify the radios are at least 10 feet from the DXM and/or rerun the binding procedure. If you find poor signal quality, common solutions include moving the DXM to a more central location relative to the Nodes or using higher-gain antennas on the DXM. Contact your local Banner Engineering representative for assistance.

Step 4: Upload the Conurton Files

There are two files loaded onto the DXM: the XML configuration file that defines the DXM's Local Register configuration and the ScriptBasic file that runs the main program. Skip these instructions and to go Step 5: Configure the Application Settings on p. 4 if your DXM1200 is pre-loaded with the XML and ScriptBasic files. The DXM1200 that comes in the PPM Kits is pre-loaded with the files.

Verify you have run the binding instructions on all Nodes, assigned Node IDs to all radios, installed the radios, and conducted a Site Survey to test the signal strength.

- Download and install Banner's DXM Configuration Software (v4 or newer) onto the computer you will be using to configure
 your files.
- Download the Production Performance Monitoring Kit configuration files (p/n b_51144830) from www.bannerengineering.com. The pre-configured files can also be found on the DXM Series Page or the Production Performance Monitoring application guide page.
- Extract the ZIP files into a folder on your computer. Note the location where the files were saved.
- Connect the DXM, using the USB Cable supplied or with an Ethernet cable, to a computer containing the DXM Configuration Software V4.
- Launch the configuration software and connect to the DXM.
- In the Configuration Mode drop-down list, select Traditional Setup.
- Select the connection mode.
 - Serial—Select the COM port the USB cable is plugged into. If you are unsure which COM port to select and multiple
 ports are listed, disconnect the USB cable and press the refresh button to see which port disappears. Reconnect the
 USB cable and select the COM port that reappeared.
 - TCP/IP—Enter the IP address of the DXM, which can be found in the DXM LCD under System Info > Ethernet > IP.
 The default static IP is 192.168.0.1. Your computer must be on the same network as the DXM.
- 8. In the Select DXM Model drop-down list, select DXM1200.
- 9. Click Connect.
- 10.To load the configuration file, go to File > Open and choose the XML file 223065.xml.
- 11.To load the ScriptBasic file, go to Settings > Scripting and click Upload File. Select the ScriptBasic file 223064.sb.
- 12.On the menu bar, go to DXM > Send Configuration to DXM.

The XML configuration file uploads to the DXM and runs the PPM program after the DXM is rebooted.

Cycle power to the DXM Controller.

Step 5: Conur the Application Settings

After uploading the configuration file to the DXM, users can modify application-specific settings directly from the DXM's menu system. Before making any changes, enable the Delay Mode via the DXM display. The PPM Kit is pre-configured to work without additional complex programming or software. For the most accurate performance metrics, we recommend that users modify the Number of Sensors, Ideal Run Rate, and Stopped Rate parameters to fit their specific production speeds.

- On the DXM, use the arrow keys to select the Registers menu and press ENTER.
- 2. Scroll down to Delay Mode and press ENTER.
- Using the arrow keys, change the value to 1 and press ENTER three times. The Delay Mode setting should now display ON.
- Use the arrow keys to modify any parameters based on the application/user requirements. See the Parameters table for parameters that are configuration using the display.
 - a) Set the Number of Sensors to the number of Q45 or TL70 devices in the system. For increased processing speed and reduced data pushed to the cloud, do not set this value higher than the actual number of devices in the network.
 - b) Set the Ideal Run Rate to the ideal line speed in parts per minute (PPM). The sensor will be in an ideal run state when the PPM is above this parameter. When the PPM value is below this parameter, the sensor is in a slow running condition. This parameter applies to all connected sensors. For individual Ideal Cycle Time parameters, set this value to 0 and modify registers 7051 and greater (not configurable with the display).
 - c) Set the Stopped Rate to the line speed in parts per minute (PPM) at which the process is considered stopped. The sensor will be in a stop condition when the PPM value is less than this parameter. This parameter applies to all connected sensors. For individual Stop Cycle Time parameters, set this value to 0 and modify registers 7101 and greater (not configurable with the display).

- After all the application settings changes are entered, disable Delay Mode by setting the Delay Mode value to 0.
- Cycle power to the DXM to apply your changes.

Table 4: Parameters

DXM Registers	Name	Description	Default Value	Cloud
951	Report Trate	Global setting for Sensor report time in seconds, for Salvery powered applications, it is not recommended to report faster than 1/minute, longer report times increase battery life. Set to 0 to use individual line report times. Sec register 7001	80	Au baauwwie
952	Минірел об Зепаруз	Indicates the number of Sersors in the system. The system cannot exceed 47 Sersors and can be a combination of Q49s or TU70s	47	Auganamie
953	Ideal Sun Sate	Grotel seving for an ideal run rate in parts per minute (PPM). Sevin Otto use individual line ideal Sun Sates. See regioner 7051	15	Auganamie
954	Suggest Rate	Gross seving for a sign condition in parts per minute (PPM). Sex to 0 to use individual suppled line rates. See register 7 101	3	Auganamie
995	Sow Nam Time	Global seuring, in seconds, for invaving a slow state darm	300	Acagolamie
996	9.00 Nam Time	Grotal seuring, in seconds, for invaving a sopplease darm	150	Acadalamie
957	9.00 Count	Successive reports below supposed rate to vigger a supposed scenario. For example, a supplement of three (3) with a report time of 60 seconds means a time will not enter a supplement into the supposed Sate for three consectainty exports or 3 minutes.	3	Агарримене
9 98	Oelay Mode	Enables soring, delay that adds a wind second war, one before starting another loop in the group and the system operates normally with this exception. This is helpful for voubleshooting the system and should be disabled during normal operation. 1 = Enabled, 0 = Orsabled	a	
820	ನಗತ್ಯುಭರಗಳ	Grotal seung, in seconds, for invaving a push rate to Barner COS.	300	1/day
960	<u> ಉತ್ಪಾಗಿಗಳಿ</u>	Enables the controller to push data to Sanner COS. Setting value of 0 to disable cloud pushing	1	
961	Lgw Рей филансе	Gross seving for a Low Performance Aleri. Sex to a value of 0 to use individual Low Performance Aleris. See register 7 191	95	Auggaweie
962	Coucal Performance	Grobal secungifier a Chical Performance Mexi. Secundaryative of this use individual Chical Performance Mexis. Sec register 7201	90	Au biggs/wwite

Step 6: Push Information to BannerCDS

The DXM Wireless Controller can connect to the Web via Ethernet or an internal cell module. The controller pushes data from the DXM to be stored and displayed on a website.

The Banner website for storing and monitoring the system's data is https://bannercds.com. The Banner Cloud Data Services website automatically generates dashboard icons and graphs for the application that is populated onto the Dashboard. Email alerts can be configured using the Alarms screen.

Create a New Gateway

After you log into the Banner CDS website, the Gateway screen displays. Follow these steps to create a new monitoring site.

Click on +New Gateway.

Create a new Gateway/site for each device that will be sending data to the web server.

Figure 1. Create a New Gateway/Site



A Create New Gateway prompt appears.

- 2. Verify Traditional is selected for the Configuration.
- Enter a site name
- 4. Under XML Config, select Choose File and upload the PPM configuration XML file: 223065.xml.
- When prompted to generate a unique gateway ID, click Yes and then click Get XML when prompted to download the file. This generates a unique ID that needs to be loaded back into the DXM. Save this file for the next step.

Click Create.

The Gateway/Site appears in the listing of devices on the **Gateways** screen and lists a status of **Waiting for device to connect**. After the DXM begins pushing data, the status changes to a green timestamp after a successful push.

Update the DXM with the Banner CDS Conurton

The DXM is automatically configured to push data to Banner CDS at 5 minute intervals. No additional configuration changes are required after downloading the modified XML that was created for this application.

- Within the DXM Configuration Software, connect to the DXM and go to the File > Open menu. Open the XML configuration file downloaded from Banner CDS for this application.
- Send the updated XML to the DXM Controller using the DXM > Send XML Configuration to DXM menu.

Completing these steps creates continuity between the site created on the website with the DXM used in the field. The DXM pushes data to the website, which can be viewed at any time.

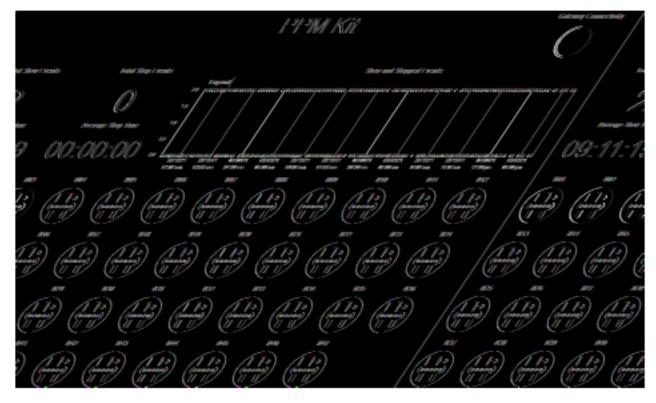


Figure Z. Majn dashboard screen

Refer to the Banner Cloud Data Services Instruction Manual to review all the features available for monitoring, comparing data, and establishing warnings/alarms on the website. To access a demo version of the website please contact your local Banner distributor and follow the instructions in the technical note: Connecting to the Banner Cloud Data Services Demo Site for modified instructions on how to send data to the demo site.

Dashboard View

The PPM Kit automatically creates two dashboards for performance monitoring. The main dashboard gives users a high level view of the system, showing the total slow and stop events and average length of events across the entire system of sensors. Individual item view dashboards give users access to view individual sensor performance, part counts, status, average ppm, and the ability to configure individual sensor settings such as run rates, stop rates, and performance thresholds.

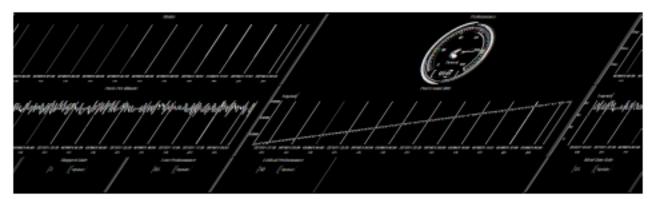


Figure 3. Item View dashboard screen for the PPM kit

Optional Conurton Steps

Clear the Sensor Data from the DXM

The Sensor Data, State, and Timer registers in the system have a reset register that can be accessed using the DXM's display, Modbus Registers, or Banner CDS. Set register 822 to a value of 1 to reset all the counters and data registers.

Follow these steps to clear the sensor data using the DXM display.

- On the DXM: Use the arrows to select Registers.
- Select the Clear Sensors register.
- Press Enter.
- Change the value to 1 then press Enter three times.

The reset register automatically returns to zero after the data is reset.

Clear the Sensor Data from Banner CDS

Follow these steps to clear the sensor data using the Banner Cloud Data Services website.

- Go to the Dashboard > Sites screen.
- Select the Dashboard name where the Call for Parts Kit exists.
- Toggle the Clear Sensors button.
- A pop-up window asks if you would like to trigger an update. Click Yes.
 An update to reset the data registers is sent to the DXM the next time the DXM pushes data to Banner CDS.

Clear the Sensor Data from the Scheduler Tool

The Sensor Data can be cleared using the DXM Configuration Software's Scheduler tool.

Synchronize the DXM's on-board clock with your PC for accurate scheduled resets. To sync the PC time with the DXM, go to Settings > System and click Sync PC time with device.

- In the DXM Configuration Software: Load the PPM configuration XML file (223065.xml).
- Go to Tools > Scheduler > Weekly Events and click Add Weekly Event.
- 3. Name the event and set the Register to 822. Register 822 is the Clear Sensors register.
- 4. Select the days that the reset will be conducted, the abbreviations will be highlighted yellow when selected.
- Set the Schedule Definition parameters.
 - a) Set the Start Value to 1.
 - b) In the Start at drop-down list, select Specific Time.
 - Set the desired reset time using 24-hour format.

This can be repeated multiple times for automatic shift resets. An End Value is not required for this functionality.

- Go to File > Save to save the changes to your configuration file.
- 7. Go to DXM > Send Configuration to DXM to upload the new configuration file to the DXM.

Set Individual Report Rates

Sensor report rates can be customized to have individual reporting (such as some sensors reporting once every minute and others every 5 minutes). For this advanced setting, the DXM must be accessed using the DXM Configuration Software, Banner CDS, or Industrial protocols (Modbus TCP/Ethernet IP).

- On the DXM: Use the arrows to select Registers.
- Select the Report Time register and press Enter.
- Change the value to 0 then press Enter three times.
- 4. Access the Individual Report Time registers (7001 through 7050).
 - a) When you are connected through the DXM Configuration Software, go to Tools > Register View > Writer Registers. Set the Starting Register to 7001. Enter a value, in seconds, and click Write registers. The individual Report Time registers can be updated one by one or in batches.
 - b) When you are connected through Banner CDS, go to the **Data** screen and find register 7001, Report Time N#. Click the update icon on the left, enter the time in seconds, and click **Save**. The parameter will update on the next push to Banner CDS.
 - c) When you are using industrial protocols, update the DXM's Local Registers 7001–7050 to reflect the individual Report Time desired for each sensor.
- After the Report Time parameter is updated, cycle the power to the DXM or set the Initialize command to 1 to update the parameters on each sensor.

Conur the Kit for a Cellular Push Interface

By default, the DXM in the Production Performance Monitoring kit is configured for an Ethernet push interface to push information to Banner CDS. To configure the system for a cellular push interface, configure the default configuration file (223065.xml) for cell capabilities. Cellular cloud connectivity requires an appropriate cellular modern and cell plan for the DXM1200.

- In the DXM Configuration Software: Load the PPM configuration XML file (223065.xml).
- Go to the Settings > Cloud Services screen and select Cell in the Push Interface drop-down list. If you are changing the configuring from Cell to Ethernet, select Ethernet and go to step 4.
 - Setting the cloud push interval is not required; the PPM ScriptBasic file controls the cloud push rate.
- 3. In the Settings > Cellular screen, select the appropriate Cell Module that is connected to your DXM from the drop-down list.
- 4. Go to File > Save to save the changes to your configuration file.
- Go to DXM > Send Configuration to DXM to upload the new configuration file to the DXM.

Interpreting the Status Registers

The Q45 All-in-one Photoelectric Sensor Nodes and Wireless TL70 Tower Light Nodes contain virtual status registers. These registers can be used to determine what state each line is in and to calculate advanced metrics.

Registers 5951 through 6000 contain the status registers. The register's value determines what state the line is in. Users can map this information to a PLC, HMI, or SCADA system for advanced analytics such as monitoring average slow/stop rates or monitoring stop events.

Table 5: Sensor state and timers

DXM Registers	Name	Register Value	Status	Description	Cloud		
		100	Off	Serson/Node is gowered on but has not begun counting			
				200	Run	Sensor is in a run state condition, line speed is greater than lideal Run Rate setting.	
5951-6000	Sensor State Net	Sensor State Nat 300 Show Sensor and advisible conductor, the speed is less than Ideal Run Rate	Sersor is in a stow state conductor, the speed is less than Ideal Sun Sate	9.W			
		400	900	Sensor is in a sign state condition. In espect is less than or equal to the Sopped Rate			

Local Registers

Table 6: Supervisory data

DXM Registers	Name	Description	Cloud
901	Giphal Run Suate	Auteas, one line is in a Run state. OR'd value of all sensors. 1 = viue	8yW
902	Global Slow Sale	At least one line is in a Slow state. OR'd value of all sensors. 1 = viue	₽₩
903	Grood Sign State	Auteasigne kneisin a Sigg state. CR'd value of all sensors. 1 = viue	8/W
90x	Total Slow Events	Sum of all Stow Counters for all sensors	8vW
905	Total Stop Events	Sum of at Stop Counters for at sensors	8vW
906	Average Sow Time	Average united (all stow events (minutes) for all sensors, local stow cine divided by local stow events	8vW
907	Average 9.00 Time	Average ome of all sopplevents (minutes) for all sensors, upor sopplome divided by upor stow events	8vW
909	Total Slow T-me	Sum of all stow unique for all sections	₽₩
909	Total Stopped Time	Sum of all sugged whes for all sensors	₽₩
910	Эрра Low Ре√оу папсе	At least one Sensor has a Low Performance Alert. OR'd value of all sensors. $1=\log t$	8yW
911	Global Criscal Performance	At least one Sensor has a Coucal Performance Alext. CR'divable of all sensors. 1 = vue	8/W

Table 7: Commands

DXM Registers	Name	Description	Default Value	Cloud
921	Inugias	Seads all parameter settings, generates node IOs and dears counters. Set to 1 to invalie, Invaliang should be executed when the Sepon Time or Number of Sensors Parameter is Changed.	۵	A boowwe
922	Clear Sensors	Oears at Sensor Oalaregraphs and Sensor States and Timers	a	Au boowwrke
923	Sync Sensors	Synchron ves Sensors in neuwork (use when Sensor is gowered ON but status is not 128). This is generally used at statup/when intra-vary the system	a	

Table & Parameters

DXM Registers	Name	Description	Default Value	Cloud
951	Septy: Time	Grobal setting for Sensor report unterin seconds, for Battery powered applications, it is not recommended to report faster than 1/minute, longer report untesincrease battery life. Set to 0 to use individual line report untest. See register 7001	80	Auggalamie
952	Number of Sensors	Indicates the number of Sensors in the system. The system cannot exceed 47 Sensors and can be a combination of Q45s or TU70s	47	Autogowwie
823	Ideal Sun Sale	Global seuing for an ideal run rate in parts per minute (PPM). Seuip Ouguse individual line ideal Run Rates. See register 7051	15	Autogowwie
824	Suggest Rate	Global setting for a soppronduction in participer minute (PPM). Set to 0 to use individual soppred line rates. See register 7 101	3	Autogowwie
995	9gw Warm Time	Global seurig, in seconds, for invaling a slow sale darm	300	Autogolawije
996	Suga Maran Trans	Gross seurg, in seconds, for invaling a soppease darm	150	Acadanimie
9 57	9.00 Count	Successive reports below supposed rate to vigger a supposed scenario. For example, a supplication of three (3) with a report time of 60 seconds means a knew time of the supplication of three consecutive reports or 3 minutes.	3	Агарамме
428	Oelay Mode	Enables soring delay that adds a two second was time before starting another loop in the grogram, the system operates normally with this exception. This is helpful for vioubleshopping the system and should be disabled during normal operation. 1 = Enabled, 0 = 0-sapled.	a	
999	Push Rate	Global seurig, in seconds, for invaling a push rate to Banner COS.	300	1/day
960	SushEngge	Engiges the convident to push data to Barner COS. Setting value of 0 to disable cloud pushing	1	
961	Low Serformance	Grotal seuing for a Low Performance Aleru. Seuro a value of Orio use individual Low Performance Alerus. See regisser 7 (\$1	9 5	Autogo.ww.e
962	Coucal Performance	Global second for a Chical Performance Mexi. Second avalue of Orginase individual Chical Performance Mexis. Sec register 7201	90	Autogowwie

Table 9: Sensor data

DXM Registers	Name	Description	Cloud
9001-9090	Pan Count Ne	Part Count for each sensor	RW.
9051-5100	Parts Per Minute (PPM) Nr	Currentline speed for each sensor . Calculated as the difference between the current count and task count are aged over $1\mathrm{minute}$	RAV
5101-5190	Average 99M Na	Averages PPM values since lass reservours dear	8W
5151-5200	Idea Sun Sale Devia on Ne	Percent offset of Ideal Run Rate using Average PPM. Reported as a signed 32 by value	RAV
5201-5290	Lass Cours N#	Lass reported count value, non cumulative	RMV

Table 10: Sensor state and timers

DXM Registers	Name	Description	Cloud
9901-9990	Synt States Net	Nami for Sensor qui of sync conducti. Value of 0 = Out of sync. Value of 129 = sensor in sync	8vW

DXM Registers	Name	Description	Cloud
9951-9800	Total Ideal Sun Time Nr	Total Time (Seconds) viativine Sensor is in a Run State condition.	8vW
9801-9850	Total Stow Time Ne	Total Time (Seconds) viativine Sensor is in a Slowed State condition.	8vW
9851-9700	Total Stop Time N4	Total Time (Seconds) viativine Sensor is in a Stopped State condition.	8vW
5701-5750	Total ON Time Ne	Total Time (Seconds) viativine Sensor is ON, sum of Ideal Run Time, Slow Time, and Slop Time	8vW
5751-5900	Average Stow T-me N#	Average Time (Seconds) that the Sensor is in Slow Sale conditions	8vW
9901-9990	Average Suga Time N#	Average Time (Seconds) that the Sensor is in Stop State conditions	8vW
9951-9900	Sign Even Open N#	Number of Start State events	8vW
9901-9990	Sigg Eveni Count N#	Number of Stop State events	8vW
9951-6000	Sensor State N4	Current Status of the Sensor, 100 = OFF, 200 = Run, 300 = Sign, 400 = Stop	8vW
6001-6050	Sensor Running N#	Sensor is in a run state conduction. Value of 1= Run	
6051-6100	Sensor Sowed Ne	Sersor is in a stow state conduction. Value of 1 = Slow	
6101-6150	Sensor Suggest N#	Sersor is in a sop save conduction. Value of 1 = Soppoed	
6151-6200	Availability Net	Sensor Availability calculated as (Ideal Run Rate Time + Slow Time) / Total ON Time	8vW
6201-6250	Performance N#	Sersor Performance calculated as (Part Count/Total CN Trine)/Ideal Run Rate	8vW
6251-6300	Law Performance Wen Net	Individual Sensor Cow Performance Alex. 1 = Alex. Acrive	
6301-6350	Criscal Performance Meri Na	Individual Sensor Cricial Performance Meri. 1= Alex Acuse	
6901-6950	Clear Count N#	Clears the Sensor States and Counter information for the designated mode (O	AL BookWine

Table 11: Individual parameters

DXM Registers	Name	Description	Cloud
7001-7090	Segon Time Ne	Individual Sensor report Times (seconds), only enabled if regioner 951 = 0	Ax BogAV/Axe
7051-7100	Idea Run Rate N#	Individual Sensor Ideal Sun Sale (SPM), only enabled if regioner 999 = 0	A BooWike
7101-7190	Siggged Rave N#	Individual Sensor Stopped Rate (PPM), only enabled if register 896 = 0	A. BooWike
7151-7200	Performance Low N#	Individual Sensor Low Performance Sewing (Percent), will only be enabled firegister "" = 0. Valid sewings are between 0 and 100.	A. SogAV/ke
7201-7290	Регіонталсе Сниса N#	Individual Sensor Criscal Performance Serving (Percent), will only be enabled if register? " = 0. Valid servings are between 0 and 100.	AL Bog/Wike